

GREATER ESSEX COUNTY DISTRICT SCHOOL BOARD

Facility Services, 280 Eugenie St. E., Windsor, Ontario N8X 2X8, TEL: (519) 966-0034, Fax: (519) 969-1530



Designated Substance Management Plan:

**Kingsville DHS
170 Main E., Kingsville, Ontario, N9Y 1A6**

Original Survey Dated: October 26, 1996

Revision Dates: August 1, 2001, June 2003, August 10, 2004, August 30, 2005, August 2006, April 2, 2007, April 26, 2008, April 26, 2009, April 26, 2010, April 26, 2011, April 26, 2012, March 1, 2013, March 1, 2014, March 1, 2015, March 1, 2016, March 1, 2017, March 1, 2018, March 1, 2019, March 1, 2020, March 1, 2021, March 1, 2022, March 1, 2023, and March 1, 2024.

Current Version: March 1, 2025

Executive Summary

The Greater Essex County District School Board (GECDSB) conducted an annual update for potential Designated Substances present in the building facility of Kingsville DHS School. This notes the conditions and locations of observed, known and suspected Designated Substances found in accessible areas of the building. Asbestos (friable and non-friable asbestos-containing materials (ACMs)), Lead, Silica, and Mercury are the four most common types of Designated Substances encountered at GECDSB sites.

Other Designated Substances such as Arsenic, Benzene, Vinyl Chloride, Acrylonitrile, Coke Oven Emissions, Ethylene Oxide and Isocyanates are not likely to be found at a typical GECDSB site.

This annual update involved reviewing and documenting known abatements, repairs and conditional changes of known or suspected Designated Substances utilizing the work order system.

The following information provides a summary of where our observed, known and suspected Designated Substances are located at this site.

Asbestos

Friable chrysotile asbestos (6-75%) is present in thermal insulation on pipe fittings and some (minor) straight run pipes located throughout the building. Friable asbestos (assumed) refractory blocks are present on welding benches in Welding Room 203. Friable chrysotile asbestos (2-10%) texture coat ceilings are present and located throughout the building. Friable asbestos (assumed) fire door linings are present throughout the building. Friable asbestos (assumed) heat shielding is assumed to be present inside ventilator units throughout the building. Non-friable chrysotile asbestos (3%) black mastic pipe wrap is present on water lines under sinks in Music Room 302. Non-friable asbestos (assumed) black mastic pipe wrap is present on pipe fittings above ceilings in several locations. Non-friable chrysotile asbestos (10-20%) thermal duct covering insulation is present in several locations throughout the building. Non-friable asbestos (assumed) vinyl floor tiles sized 9" x 9" are present throughout the building. Non-friable

asbestos (assumed) transite ducting, painted transite panels on walls and transite panels inside fume hoods are present in several locations throughout the building. Non-friable asbestos (assumed) chalkboards are present throughout the building. Non-friable asbestos (assumed) gold and white anti-sweat mastics are present on the underside of sinks throughout the building. Non-friable asbestos (assumed) Bakelite countertops are present in several locations throughout the building. Non-friable asbestos (assumed) interior caulking is present on windows and doors in several areas throughout the building. Non-friable chrysotile asbestos (0.5-3%) vinyl floor tiles sized 12' x 12" are present in several locations throughout the building. Non-friable asbestos (assumed) interior and exterior caulking and firestop type materials are present at doors, windows and building penetrations. These friable and non-friable ACMs were found to be in good to fair physical condition (refer to tables and floor plans for more information).

Migration Hall

Friable asbestos (assumed) vermiculite insulation is assumed to be present inside concrete block walls around the perimeter of the building. Non-friable asbestos (assumed) gold anti-sweat mastic is present on the underside of sinks throughout the building. Non-friable asbestos (assumed) interior, exterior caulking and firestop type materials are present on windows and doors as well as building penetrations throughout. Non-friable asbestos (assumed) drywall joint compound is present on drywall finishes in several locations throughout the building. These friable and non-friable ACMs were found to be in good to fair physical condition (refer to tables and floor plans for more information).

Lead

The original building structure known as Kingsville District HS was constructed in 1953 and therefore all paints and varnishes utilized per the original building structure are assumed to contain Lead.

Building additions and renovations took place in 1962, 1967, and in 1971. All paints and varnishes utilized per these building additions and renovations would also be assumed to contain Lead.

A locker renovation took place prior to 2014 in which lead paint was found to be present up to 64,000 PPM. This was remediated at the time.

Migration Hall was constructed in 1993 in which all paints and varnishes utilized would fall under the 1992 Coatings Regulation and would be < 600 PPM Lead.

It should be noted that materials such as piping, machinery, equipment and batteries may also possibly contain Lead.

Silica

All concrete, bricks, masonry, terrazzo, mortar, ceramic floors, ceiling tiles, sand and like materials are assumed to contain Silica.

On occasion an Arts/Pottery class may take place in which they utilize Clay Body 700 which is 0.5% silica containing. No sanding is conducted and all such pottery work is done while wet/moist.

On occasion schools may wish to purchase sand for curriculum related activities. Such sand purchases are to be made through Webstock and the sand has to be Silica Free.

Mercury

Possible Mercury containing thermostats, thermometers, switches, batteries and fluorescent lamp tubes are assumed to contain Mercury.

Disclaimer

The information and opinions rendered in this report are exclusively for use by the above noted. Additional Designated Substances may exist at this site in non-accessible areas as well as in enclosed areas behind walls, ceilings or floor surfaces which were not accessible. The Health & Safety Department does not warrant nor represent that all designated substances have been identified in the building facility.

Tim Lauzon, I. H., E. P.,
Health & Safety Officer
2024 - 2025 School Year

ESSEX COUNTY BOARD OF EDUCATION

KINGSVILLE DISTRICT HIGH SCHOOL

Asbestos Analysis

<u>Sample I.D.</u>	<u>Location</u>	<u>Condition</u>	<u>% asbestos and type</u>
KDH1	2' x 4' ceiling tile (room 307)	good	n/a
KDH2	2' x 4' ceiling tile (in hall by room 304)	good	n/a
KDH3	18" x 18" ceiling tile	good	n/a
KDH4	18" x 18" ceiling tile	good	n/a
KDH5	10" x 10" ceiling tile (in 500 hall)	good	n/a
KDH6	10" x 10" ceiling tile (in 500 hall)	good	n/a
KDH7	Ceiling plaster in staff lounge	good	5-10% chrysotile
KDH8	Ceiling plaster in cafeteria	good	5-10% chrysotile
KDH9	Pipe insulation in tunnel in hall by rooms 501 - 503 (smaller pipe) Corrugated card- board	poor	50-75% chrysotile
KDH10	Pipe insulation in tunnel (corrugated card- board) under library	poor	50-75% chrysotile
KDH11	Pipe elbow in in tunnel by room 501 - 503	good	20-30% chrysotile

KDH12	Pipe elbow in tunnel by library	good	20-30% chrysotile
KDH13	Pipe insulation in hall over ceiling tile by room 205	good	n/a
KDH14	Pipe elbow in hall over ceiling tile by room 203	good	10-20% chrysotile
KDH15	Hot water tank in boiler room	good	20-30% chrysotile
KDH16	Stack cement on boiler #1	good	20-30% chrysotile
KDH17	Stack cement on boiler #2	good	20-30% chrysotile
KDH18	Stack cement on boiler #3	good	20-30% chrysotile
KDH19	Pipe insulation on old oil pipe (blue)	good	n/a
KDH20	ceiling plaster in Room 406	good	5-10% chrysotile
KDH21	Ceiling plaster in 400 Hall	good	5-10% chrysotile

Certificate of Analysis

Indoor Environmental Specialists Inc.

330 Richmond Street Unit 101
Chatham, ON N7M 1P5
Attn: Chris Croft

Client PO: C3518
Project: C3518
Custody:

Report Date: 4-Mar-2019
Order Date: 27-Feb-2019

Order #: 1909292

This Certificate of Analysis contains analytical data applicable to the following samples as submitted:

Paracel ID	Client ID
1909292-01	2018-0001F - Plaster
1909292-02	2018-0001G - Plaster
1909292-03	2018-0002B - 2x4 ACT Lg & Tiny Ph & Med Random Fissure
1909292-04	2018-0002C - 2x4 ACT Lg & Tiny Ph & Med Random Fissure
1909292-05	2018-0003B - Black Baseboard Mastic
1909292-06	2018-0003C - Black Baseboard Mastic
1909292-07	2018-0004B - Tar Paper on Ducting
1909292-08	2018-0004C - Tar Paper on Ducting
1909292-09	2018-0005B - Brown Baseboard Mastic
1909292-10	2018-0005C - Brown Baseboard Mastic
1909292-11	2018-0006B - 2x4 ACT Med Width Fissures w/Med Pinholes
1909292-12	2018-0006C - 2x4 ACT Med Width Fissures w/Med Pinholes
1909292-13	2018-0007B - 12x12 Off-White VFT w/Many Brown Streaks
1909292-14	2018-0007C - 12x12 Off-White VFT w/Many Brown Streaks
1909292-15	2018-0008A - 12x12 Orange VFT w/ White Streaks
1909292-16	2018-0008B - 12x12 Orange VFT w/ White Streaks
1909292-17	2018-0008C - 12x12 Orange VFT w/ White Streaks
1909292-18	2018-0009A - 12x12 Beige VFT w/ Few Brown and Black Streaks
1909292-19	2018-0009B - 12x12 Beige VFT w/ Few Brown and Black Streaks
1909292-20	2018-0009C - 12x12 Beige VFT w/ Few Brown and Black Streaks
1909292-21	2018-0010A - Drywall Joint Compound
1909292-22	2018-0010B - Drywall Joint Compound
1909292-23	2018-0010C - Drywall Joint Compound
1909292-24	2018-0011A - 12x12 Beige VFT w/Many Grey/Dark Grey Flecks
1909292-25	2018-0011B - 12x12 Beige VFT w/Many Grey/Dark Grey Flecks
1909292-26	2018-0011C - 12x12 Beige VFT w/Many Grey/Dark Grey Flecks

Approved By:



Emma Diaz
Senior Analyst

Any use of these results implies your agreement that our total liability in connection with this work, however arising, shall be limited to the amount paid by you for this work, and that our employees or agents shall not under any circumstances be liable to you in connection with this work.

 Certificate of Analysis**Client:** Indoor Environmental Specialists Inc.**Report Date:** 04-Mar-2019**Order Date:** 27-Feb-2019**Client PO:** C3518**Project Description:** C3518

1909292-27	2018-0012A - 2x4 ACT Lg & Med Pinhole Swirl Pattern
1909292-28	2018-0012B - 2x4 ACT Lg & Med Pinhole Swirl Pattern
1909292-29	2018-0012C - 2x4 ACT Lg & Med Pinhole Swirl Pattern
1909292-30	2018-0013A - Black Mastic Pipe Wrap
1909292-31	2018-0013B - Black Mastic Pipe Wrap
1909292-32	2018-0013C - Black Mastic Pipe Wrap
1909292-33	2018-0014A - 12x12 Off-White VFT w/Light Brown Streaks
1909292-34	2018-0014B - 12x12 Off-White VFT w/Light Brown Streaks
1909292-35	2018-0014C - 12x12 Off-White VFT w/Light Brown Streaks
1909292-36	2018-0015A - 2x2 ACT w/Large Pinholes
1909292-37	2018-0015B - 2x2 ACT w/Large Pinholes
1909292-38	2018-0015C - 2x2 ACT w/Large Pinholes
1909292-39	2018-0016A - Cellulose on RWL
1909292-40	2018-0016B - Cellulose on RWL
1909292-41	2018-0016C - Cellulose on RWL
1909292-42	2018-0017A - Trowelled on Firestop
1909292-43	2018-0017B - Trowelled on Firestop
1909292-44	2018-0017C - Trowelled on Firestop
1909292-45	2018-0018A - 18x18 ACT w/Stippled Plaster Type Pattern
1909292-46	2018-0018B - 18x18 ACT w/Stippled Plaster Type Pattern
1909292-47	2018-0018C - 18x18 ACT w/Stippled Plaster Type Pattern



Certificate of Analysis

Client: Indoor Environmental Specialists Inc.

Client PO: C3518

Report Date: 04-Mar-2019

Order Date: 27-Feb-2019

Project Description: C3518

Asbestos, PLM Visual Estimation **MDL - 0.5%**

Parcel ID	Sample Date	Colour	Description	Asbestos Detected	Material Identification	% Content
1909292-01	25-Feb-19	Grey/White	Plaster	No	Client ID: 2018-0001F - Plaster Non-Fibers	[ASLVR] 100
1909292-02	25-Feb-19	Grey/White	Plaster	No	Client ID: 2018-0001G - Plaster Non-Fibers	[ASLVR] 100
1909292-03	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0002B - 2x4 ACT Lg & Tiny Ph & Med Random Fibers Cellulose MMVF Non-Fibers	30 50 20
1909292-04	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0002C - 2x4 ACT Lg & Tiny Ph & Med Random Fibers Cellulose MMVF Non-Fibers	40 30 30
1909292-05	25-Feb-19	Yellow	Mastic	No	Client ID: 2018-0003B - Black Baseboard Mastic Non-Fibers	100
1909292-06	25-Feb-19	Yellow	Mastic	No	Client ID: 2018-0003C - Black Baseboard Mastic Non-Fibers	100
1909292-07	25-Feb-19	Black	Tar Paper	No	Client ID: 2018-0004B - Tar Paper on Ducting Cellulose MMVF Non-Fibers	25 5 70
1909292-08	25-Feb-19	Black	Tar Paper	No	Client ID: 2018-0004C - Tar Paper on Ducting Cellulose MMVF Non-Fibers	25 5 70
1909292-09	25-Feb-19	Brown	Mastic	No	Client ID: 2018-0005B - Brown Baseboard Mastic Non-Fibers	100

Certificate of Analysis

Client: Indoor Environmental Specialists Inc.

Client PO: C3518

Report Date: 04-Mar-2019

Order Date: 27-Feb-2019

Project Description: C3518

Asbestos, PLM Visual Estimation **MDL - 0.5%**

Parcel ID	Sample Date	Colour	Description	Asbestos Detected	Material Identification	% Content
1909292-10	25-Feb-19	Brown	Mastic	No	Client ID: 2018-0005C - Brown Baseboard Mastic	
					Non-Fibers	100
1909292-11	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0006B - 2x4 ACT Med Width Fissures w/Med Pinholes	
					Cellulose	40
					MMVF	30
					Non-Fibers	30
1909292-12	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0006C - 2x4 ACT Med Width Fissures w/Med Pinholes	
					Cellulose	40
					MMVF	30
					Non-Fibers	30
1909292-13	25-Feb-19	Off-white/Black	Vinyl Floor Tile/Mastic	Yes	Client ID: 2018-0007B - 12x12 Off-White VFT w/Many Brown Streaks	(ASL/R)
					Chrysotile	2
					Non-Fibers	98
1909292-14	25-Feb-19				Client ID: 2018-0007C - 12x12 Off-White VFT w/Many Brown Streaks	
					not analyzed	
1909292-15	25-Feb-19	Orange/Black	Vinyl Floor Tile/Mastic	Yes	Client ID: 2018-0008A - 12x12 Orange VFT w/ White Streaks	(ASL/R)
					Chrysotile	3
					Non-Fibers	97
1909292-16	25-Feb-19				Client ID: 2018-0008B - 12x12 Orange VFT w/ White Streaks	
					not analyzed	
1909292-17	25-Feb-19				Client ID: 2018-0008C - 12x12 Orange VFT w/ White Streaks	
					not analyzed	
1909292-18	25-Feb-19	Beige/Black	Vinyl Floor Tile/Mastic	Yes	Client ID: 2018-0008A - 12x12 Beige VFT w/ Few Brown and Black Streaks	(ASL/R, AS-PT)
					[ASTrc]Chrysotile	<MDL
					Non-Fibers	100

Certificate of Analysis

Client: Indoor Environmental Specialists Inc.

Client PO: C3518

Report Date: 04-Mar-2019

Order Date: 27-Feb-2019

Project Description: C3518

Asbestos, PLM Visual Estimation **MDL - 0.5%**

Parcel ID	Sample Date	Colour	Description	Asbestos Detected	Material Identification	% Content
1909292-19	25-Feb-19	Beige/Black	Vinyl Floor Tile/Mastic	Yes	Client ID: 2018-0009B - 12x12 Beige VFT w/ Few Brown and Black Streaks Chrysotile Non-Fibers	[ASLYR, AS-PT] 0.5 99.5
1909292-20	25-Feb-19				Client ID: 2018-0009C - 12x12 Beige VFT w/ Few Brown and Black Streaks not analyzed	
1909292-21	25-Feb-19	Grey	Drywall Joint Compound	No	Client ID: 2018-0010A - Drywall Joint Compound Non-Fibers	100
1909292-22	25-Feb-19	Grey	Drywall Joint Compound	No	Client ID: 2018-0010B - Drywall Joint Compound Non-Fibers	100
1909292-23	25-Feb-19	Grey	Drywall Joint Compound	No	Client ID: 2018-0010C - Drywall Joint Compound Non-Fibers	100
1909292-24	25-Feb-19	Beige/Black	Vinyl Floor Tile/Mastic	No	Client ID: 2018-0011A - 12x12 Beige VFT w/ Many Grey/Dark Grey Flecks Non-Fibers	[ASLYR] 100
1909292-25	25-Feb-19	Beige/Black	Vinyl Floor Tile/Mastic	No	Client ID: 2018-0011B - 12x12 Beige VFT w/ Many Grey/Dark Grey Flecks Non-Fibers	[ASLYR] 100
1909292-26	25-Feb-19	Beige/Black	Vinyl Floor Tile/Mastic	No	Client ID: 2018-0011C - 12x12 Beige VFT w/ Many Grey/Dark Grey Flecks Non-Fibers	[ASLYR] 100
1909292-27	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0012A - 2x4 ACT Lg & Med Pinhole Swirl Pattern Cellulose MMVF Non-Fibers	40 30 30
1909292-28	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0012B - 2x4 ACT Lg & Med Pinhole Swirl Pattern Cellulose MMVF Non-Fibers	40 30 30

Certificate of Analysis

Client: Indoor Environmental Specialists Inc.

Client PO: C3518

Report Date: 04-Mar-2019

Order Date: 27-Feb-2019

Project Description: C3518

Asbestos, PLM Visual Estimation **MDL - 0.5%**

Parcel ID	Sample Date	Colour	Description	Asbestos Detected	Material Identification	% Content
1909292-29	25-Feb-19	Beige	Ceiling Tile	No	Client ID: 2018-0012C - 2x4 ACT Lg. & Med Pinhole Swirl Pattern	
					Cellulose	40
					MMVF	30
					Non-Fibers	30
1909292-30	25-Feb-19	Black	Mastic	Yes	Client ID: 2018-0013A - Black Mastic Pipe Wrap	
					Chrysotile	3
					Non-Fibers	97
1909292-31	25-Feb-19				Client ID: 2018-0013B - Black Mastic Pipe Wrap	
					not analyzed	
1909292-32	25-Feb-19				Client ID: 2018-0013C - Black Mastic Pipe Wrap	
					not analyzed	
1909292-33	25-Feb-19	Off-white	Vinyl Floor Tile	No	Client ID: 2018-0014A - 12x12 Off-White VFT w/Light Brown Streaks	
					Non-Fibers	100
1909292-34	25-Feb-19	Off-white	Vinyl Floor Tile	No	Client ID: 2018-0014B - 12x12 Off-White VFT w/Light Brown Streaks	
					Non-Fibers	100
1909292-35	25-Feb-19	Off-white	Vinyl Floor Tile	No	Client ID: 2018-0014C - 12x12 Off-White VFT w/Light Brown Streaks	
					Non-Fibers	100
1909292-36	25-Feb-19				Client ID: 2018-0015A - 2x2 ACT w/Large Pinholes	
					not analyzed	
1909292-37	25-Feb-19	Brown/Grey	Ceiling Tile	No	Client ID: 2018-0015B - 2x2 ACT w/Large Pinholes	
					Cellulose	30
					MMVF	65
					Non-Fibers	5
1909292-38	25-Feb-19	Grey	Ceiling Tile	No	Client ID: 2018-0015C - 2x2 ACT w/Large Pinholes	
					MMVF	85
					Non-Fibers	15

Certificate of Analysis

Client: Indoor Environmental Specialists Inc.

Client PO: C3518

Report Date: 04-Mar-2019

Order Date: 27-Feb-2019

Project Description: C3518

Asbestos, PLM Visual Estimation **MDL - 0.5%**

Parcel ID	Sample Date	Colour	Description	Asbestos Detected	Material Identification	% Content
1909292-39	25-Feb-19				Client ID: 2018-0016A - Cellulose on RWL not analyzed	[Z-01]
1909292-40	25-Feb-19	Brown/Black	Cellulose	No	Client ID: 2018-0016B - Cellulose on RWL Cellulose Non-Fibers	70 30
1909292-41	25-Feb-19	Brown/Black	Cellulose	No	Client ID: 2018-0016C - Cellulose on RWL Cellulose Non-Fibers	70 30
1909292-42	25-Feb-19	Grey	Firestop	No	Client ID: 2018-0017A - Trowelled on Firestop Non-Fibers	100
1909292-43	25-Feb-19	Grey	Firestop	No	Client ID: 2018-0017B - Trowelled on Firestop Non-Fibers	100
1909292-44	25-Feb-19	Grey	Firestop	No	Client ID: 2018-0017C - Trowelled on Firestop Non-Fibers	100
1909292-45	25-Feb-19	Grey	Ceiling Tile	No	Client ID: 2018-0018A - 18x18 ACT w/ Stippled Plaster Type Pattern MMVF Non-Fibers	85 15
1909292-46	25-Feb-19	Grey	Ceiling Tile	No	Client ID: 2018-0018B - 18x18 ACT w/ Stippled Plaster Type Pattern MMVF Non-Fibers	85 15
1909292-47	25-Feb-19	Grey	Ceiling Tile	No	Client ID: 2018-0018C - 18x18 ACT w/ Stippled Plaster Type Pattern MMVF Non-Fibers	85 15

* MMVF: Man Made Vitreous Fibers: Fiberglass, Mineral Wool, Rockwool, Glasswool

** Analytes in bold indicate asbestos mineral content.

 Certificate of Analysis**Client:** Indoor Environmental Specialists Inc.**Client PO:** C3518**Report Date:** 04-Mar-2019**Order Date:** 27-Feb-2019**Project Description:** C3518**Analysis Summary Table**

Analysis	Method Reference/Description	Lab Location	NVLAP Lab Code *	Analysis Date
Asbestos, PLM Visual Estimation	by EPA 600/R-93/116	1 - Mississauga	200863-0	27-Feb-19

* Reference to the NVLAP term does not permit the user of this report to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.

Qualifier Notes**Sample Qualifiers :**

ASLYR: Layers were noted for this sample, however, the entire sample was homogenized per client request.

AS-PT: Asbestos quantitation by PLM Point Count method.

ASTrc: Trace asbestos was observed below the noted detection limit but could not be accurately quantified.

Z-01: No Sample

Work Order Revisions | Comments

None



School: Kingsville District Highschool

Supplementary Certificate of Analysis

Sample ID	Description and Location	% Asb & Type
K-01	Thermal Insulation Small and Large Fittings	21% CHR
K-02	Ceiling Tiles	Non-ACM
K-03	Baseboard Mastic	Non-ACM
K-04	Baseboard Mastic	Non-ACM
K-05	Thermal Insulation Pipe Straights	Non-ACM
K-06	Ceiling Plaster	Non-ACM
K-07	Ceiling Tiles	Non-ACM
K-08	Gaskets	
K-09	Thermal Insulation Duct Covering	
K-10	Breeching	
K-11	Hot Water Storage Tank	
K-12	Thermal Insulation Duct Covering	
K-13	Ceiling Tiles	Non-ACM
K-14	Upper Texture Coat Ceiling	5-10% CHR
K-15	Wall Texture Coat	Non-ACM

School: Kingsville District Highschool

Supplementary Certificate of Analysis

Sample ID	Description and Location	% Asb & Type
K-16	Vinyl Floor Tiles 12" x 12"	Non-ACM
K-17	Upper Ceiling Tiles	Non-ACM
K-18	Thermal Insulation Pipe Covering	6% CHR
K-18A	Texture Coat	2-4% CHR
K-19	Ceiling Tiles	Non-ACM
K-20	Thermal Insulation Duct Covering	10-20% CHR

Sample ID	Description and Location	% Asb & Type
KDHS-01	Ceiling Tiles	Non-ACM
KDHS-02	Wall Tiles	Non-ACM
KDHS-03	Thermal Insulation Pipe Straights & Fittings	Non-ACM

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Machine Shop Room 201 1st Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Small Fittings	SK-01	X	X			X		21% CHR	Yes	
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		Fibreglass Insulation Present on Rain Water Leader
	Thermal Insulation Large Fittings	VK-01	X	X		X			21% CHR	Yes	
	Ceiling Tiles	SK-02							Non-ACM		
Classroom 201A 1st Floor Level	Baseboard Mastic	SK-03							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Repaired March 2009
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos. Repairs done January 26, 2023
	Thermal Insulation Pipe Straights										
	Thermal Insulation Small Fittings	VK-01	X	X		X	X		21% CHR	Yes	
Welding Room 203 1st Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos. Repairs done July 23, 2021.
	Refractory Block		X	X		X			Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		Fibreglass Insulation Present on Rain Water Leader
	Thermal Insulation Large Fittings	VK-01	X	X			X		21% CHR	Yes	Present on Rain Water Leader
	Ceiling Tiles	VK-02							Non-ACM		New Material Observed 2018
Classroom 203A 1st Floor Level	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos. Repairs done January 26, 2023 and April 11, 2023
	Baseboard Mastic	SK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
202 1st Floor Level	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Repairs Done May 13, 2015, Loft Repairs Aug 29, 2016 and July 2020, Mar13, 20
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		Fibreglass Insulation Present on Rain Water Leader
	Thermal Insulation Small Fittings	VK-01	X	X		X			21% CHR	Yes	
	Thermal Insulation Large Fittings	VK-01	X	X			X		21% CHR	Yes	
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Interior Caulking		X	X		X			Assumed	No	Assumed Asbestos
S20 1st Floor Level	Baseboard Mastic	VK-03 V2018-0003							Non-ACM		
	Plaster Ceiling	SK-06							Non-ACM		Not Observed 2018
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	VK-03							Non-ACM		
	Plaster	VK-06							Non-ACM		
	White Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
202A 1st Floor Level	Ceiling Tiles	SK-07							Non-ACM		
	Ceiling Tiles	S2018-0006C							Non-ACM		
	Plaster Ceiling	VK-06							Non-ACM		
	Thermal Insulation Pipe Fittings	VK-01	X	X		X	X		21% CHR	Yes	1 Fair Fitting repaired August 2019
	Interior Caulking		X	X		X			Assumed	No	Assumed Asbestos
	Drywall Joint Compound	S2018-0010A-C							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Abated January 2017 Observed 2018

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Room S17 1st Floor Level	Upper Texture Coat Ceiling	VK-14							5-10% CHR		Not Observed 2018
	Plaster Ceiling	V2018-0001							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Fittings	VK-01	X	X			X		21% CHR	Yes	
Electrical Room (E1) 1st Floor Level	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Upper Texture Coat Ceiling	VK-14							5-10% CHR		No Access Above Not Observed 2018
	Plaster Ceiling	V2018-0001							Non-ACM		
	Plaster Ceiling	VK-06							Non-ACM		No Access Above
S16 1st Floor Level	Ceiling Tiles								Non-ACM		New Material Observed 2018
	Plaster Ceiling	VK-06							Non-ACM		No Access Above
	Baseboard Mastic	VK-04							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	S2018-0008C	X	X		X			3% CHR	No	
W15 1st Floor Level	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Plaster Ceiling	VK-06		X					Non-ACM		No Access Above
	Ceiling Tiles	VK-02							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos. Repairs done February 27, 2023.
OF19 1st Floor Level	Baseboard Mastic	VK-03							Non-ACM		
	Plaster Wall	VK-06							Non-ACM		
	Plaster Ceiling	VK-06							Non-ACM		(Washroom)

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
S15 1st Floor Level									Non-ACM		No Suspect Materials
S14 1st Floor Level	Upper Texture Coat Ceiling	VK-14							5-10% CHR		No Access Above Not Observed 2018
	Plaster Ceiling	V2018-0001							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Patches of New 12" x 12" Floor Tiles
Woodworking Room 205 1st Floor Level	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Repaired Nov 29, 2005. Repaired again on Aug 5, 2021.
	Transite Duct		X	X		X			Assumed	No	Assumed Asbestos
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		Fibreglass Insulation Present on Rain Water Leader
	Thermal Insulation Small Fittings	VK-01	X	X		X	X		21% CHR	Yes	
	Thermal Insulation Large Fittings	VK-01	X	X			X		21% CHR	Yes	Present on Rain Water Leader
	Ceiling Tiles	VK-02							Non-ACM		New Material Observed 2018
Classroom 205A 1st Floor Level	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Removed March 2007, New 12" x 12" Floor Tiles
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Repairs Done March 18, 2009
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible		
Auto Mechanics 207 1st Floor Level	Thermal Insulation Pipe Straights									Fiberglass Insulation
	Thermal Insulation Pipe Straights	VK-05								Fiberglass Insulation Present on Rain Water Leader
	Fire Door		X	X				X	Yes	Assumed Asbestos Repaired Nov 29, 2005
	Transite Duct		X	X		X			No	Assumed Asbestos
	Thermal Insulation Small Fittings	VK-01	X	X		X	X		Yes	
	Thermal Insulation Large Fittings	VK-01	X	X			X		Yes	Present on Rain Water Leader
Classroom 207A 1st Floor Level	Ceiling Tiles	VK-02								
	Ceiling Tiles	V2018-0002								
	Vinyl Floor Tiles 9" x 9"									Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
	Fire Door		X	X				X	Yes	Assumed Asbestos
	Baseboard Mastic	VK-04								
	Ceiling Tiles	VK-07								New Material Observed 2018
Classroom 204 1st Floor Level	Fire Door		X	X				X	Yes	Assumed Asbestos
	Baseboard Mastic	VK-03								New Material
	Interior Caulking									Assumed Asbestos
	Gold Mastic on Sink		X	X		X			No	
	Vinyl Floor Tiles 12" x 12"									New Material
	Vinyl Floor Tiles 9" x 9"		X	X		X			No	Assumed Asbestos Mostly Abated Summer 2010, Still Present Under Sink

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 206 1st Floor Level	Ceiling Tiles	VK-07							Non-ACM		New Material Observed 2018
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Baseboard Mastic	VK-03							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Repaired Jan 22, 2008 Repairs Feb 6, 2017
Boiler Room 1 1st Floor Level	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation Abated Summer 2001
	Thermal Insulation Duct Covering	VK-09							Non-ACM		Fibreglass Insulation Abated Summer 2001
	Interior Caulking		X	X			X		Assumed	No	Assumed Asbestos
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Plaster Ceiling	VK-06							Non-ACM		
	Flex Connector								Non-ACM		New Material
	Boilers (3)	SK-09							Non-ACM		New
	Gaskets	SK-08							Non-ACM		Abated 2001
	Breeching	SK-10							Non-ACM		Abated Summer 2001 Fibreglass Insulation Abated Summer 2001
	Hot Water Storage Tank	SK-11							Non-ACM		Fibreglass Insulation Abated Summer 2001
	Domestic Hot Water Tank								Non-ACM		Fibreglass Insulation Abated Summer 2001
	Thermal Insulation Small Fittings	VK-01							21% CHR		Fibreglass Insulation Abated Summer 2001
	Thermal Insulation Large Fittings	VK-01							21% CHR		Fibreglass Insulation Abated Summer 2001

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Staff 1, W11 1st Floor Level	Plaster Ceiling	VK-06							Non-ACM		No Access Above
	Plaster Ceiling	S2018-0001G							Non-ACM		Sampled in Staff 1
	Texture Coat Ceiling	SKDH7							5-10% CHR		Not Observed 2018
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Fittings		X	X			X		Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Abated in W11 Prior 2010 Present in Staff 1
W12, W13 1st Floor Level	Baseboard Mastic	VK-03 V2018-0003							Non-ACM		
	Upper Texture Coat Ceiling	VK-14							5-10% CHR		Not Observed 2018
	Plaster Ceiling	V2018-0001							Non-ACM		
OF22, W17 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	No Access Above
	Plaster Ceiling	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Present in OF22 Only
	Vinyl Floor Tiles 12" x 12"	S2018-0009A	X	X		X			0.5% CHR	No	Present in W17 Only
	Baseboard Mastic	S2018-0003C							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
OF23, W16 1st Floor Level	Upper Texture Coat Ceiling	VK-14							5-10% CHR		No Access Above Not Observed 2018
	Plaster Ceiling	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Abated June 29, 2006, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
S11 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X		X			5% CHR	Yes	No Access Above
	Plaster Ceiling	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	V2018-0005							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
S21 1st Floor Level	Plaster Ceiling	V2018-0001							Non-ACM		No Access Above

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Gym 1st Floor Level	Thermal Insulation Pipe Straights	VK-05							Non-ACM		Fibreglass Insulation Present on Rain Water Leader
	Baseboard Mastic	V2018-0003							Non-ACM		
	Plaster	V2018-0001							Non-ACM		
	Dividing Wall								Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
Stage 1st Floor Level	Thermal Insulation Fittings	VK-01							21% CHR		Minor Abatement Mar 14, 2005 Not Observed 2018
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR		No Access Under
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	V2018-0003							Non-ACM		
	Plaster Ceiling	V2018-0001							Non-ACM		
Upper Mechanical (M4) Room Off Stage (East) 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	No Access Above
	Plaster Ceiling	V2018-0001							Non-ACM		
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Flex Connector								Non-ACM		New Material
	Thermal Insulation Duct Covering	S2018-0004C							Non-ACM		
	Thermal Insulation Duct Covering	SK-12							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Friable (Y/N)	Asbestos Content	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Upper Room Off Stage (West) (M3) 1st Floor Level	Plaster Ceiling	V2018-0001								Non-ACM	
	Thermal Insulation Pipe Straights									Non-ACM	Fibreglass Insulation
	Flex Connector									Non-ACM	New Material
	Thermal Insulation Duct Covering	V2018-0004								Non-ACM	
Dressing Room 1, 2, 3, 4 1st Floor Level	Thermal Insulation Duct Covering	VK-12								Non-ACM	
	Upper Texture Coat Ceiling	VK-14	X	X		X			Yes	5-10% CHR	No Access Above
	Plaster Ceiling	V2018-0001								Non-ACM	
	Plaster Ceiling	V2018-0001								Non-ACM	
W18 / W14 1st Floor Level Cav's Cove S9 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X		X			Yes	5-10% CHR	No Access Above
	Plaster Ceiling	V2018-0001								Non-ACM	
	Vinyl Floor Tiles 9" x 9"		X	X		X			No	Assumed	Assumed Asbestos
	Fire Door		X	X				X	Yes	Assumed	Assumed Asbestos
	Baseboard Mastic	S2018-0005C								Non-ACM	
	Baseboard Mastic	VK-04								Non-ACM	

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 401 1st Floor Level	Ceiling Tiles	SK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	SK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door								Assumed		Assumed Asbestos Removed Jan 17, 2015
	Interior Caulking								Non-ACM		New Material
	Chalkboard					X			Assumed	No	Assumed Asbestos
	Wall Texture Coat	SK-15	X	X					Non-ACM		
	Plaster	VK-06							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos Repairs January 24, 2008
	Baseboard Mastic	VK-04							Non-ACM		
	Thermal Insulation Pipe Straights	SKDH9		X				X	50-75 % CHR	Yes	Cellulose Present in Tunnel in Hall by Rooms 501-503
Tunnels (No Access)	Thermal Insulation Pipe Straights	SKDH10		X				X	50-75 % CHR	Yes	Cellulose Present in Tunnel Under Library
	Thermal Insulation Pipe Fitting	SKDH11	X	X				X	20-30 % CHR	Yes	Present in Tunnel by Rooms 501-503
	Thermal Insulation Pipe Fitting	SKDH12	X	X				X	20-30 % CHR	Yes	Present in Tunnel Under Library

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 402 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Plaster	VK-06							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
OF25 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Interior Caulking								Non-ACM		New Material
	Baseboard Mastic	VK-04							Non-ACM		
	Baseboard Mastic	V2018-0005							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
											Repaired Jan 16, 2008 / Jan 4, 2016 / Oct 19, 2016

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 403 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Repairs Feb 14, 2008 New 12" x 12" Floor Tiles June 29, 2009
	Interior Caulking								Non-ACM		New Material
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
Classroom 404 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Plaster	VK-06							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	SK-16							Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 405 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door		X	X			X		Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Plaster	VK-06							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	V2018-0005							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
OF24 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	
	Plaster	VK-06							Non-ACM		New Material
	Interior Caulking								Non-ACM		Assumed Asbestos Repairs Done Summer 2005 Abated, New 12" x 12" Floor Tiles
	Vinyl Floor Tiles 9" x 9"								Assumed		
	Baseboard Mastic	VK-03							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 406 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14 SKDH20	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door	VK-15	X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-06							Non-ACM		
	Plaster								Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Repairs Dec 23, 2007 Abated Prior 2010, New 12" x 12" Tiles
OF10, OF10A 1st Floor Level	Baseboard Mastic	VK-04							Non-ACM		New Material Observed 2018
	Ceiling Tiles	VK-13							Non-ACM		
	Plaster Wall	VK-06							Non-ACM		
	Upper Plaster Ceiling	VK-06							Non-ACM		No Access Above
	Baseboard Mastic	VK-04 V2018-0003							Non-ACM		
	Ceiling Tiles	VK-13							Non-ACM		New Material Observed 2018
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
Classroom 407 1st Floor Level	Fire Door	VK-15	X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-06							Non-ACM		
	Plaster								Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Retiled Summer 2007, New 12" x 12" Tiles
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Rifle Range Basement Floor Level	Ceiling Tiles	SK-17 SKDHS-01							Non-ACM		Not Observed 2018
	Wall Tiles	VK-17 KDHS-02							Non-ACM		Not Observed 2018
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation Not Observed 2018
SW6	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	
	Plaster	V2018-0001							Non-ACM		
	Thermal Insulation Pipe Straights & Fittings	SKDHS-03							Non-ACM		Fibreglass Insulation No Access
Tunnels Basement Floor Level OF11 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Plaster	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 409 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos. One blackboard damaged and replaced March 15, 2022
	Plaster	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		New Material Observed 2018
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
Classroom 410 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Plaster	V2018-0001							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Interior Caulking		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		New Material Observed 2018
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
									Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 411 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Plaster	V2018-0001							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		New Material Observed 2018
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
Classroom 412 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Upper Texture Coat Ceiling	VK-14	X	X		X			5-10% CHR	Yes	Repair Work Done Summer 2004
	Plaster	V2018-0001							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Wall Texture Coat	VK-15							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos. Repairs done by May 4, 2023 and November 27, 2023.
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
									Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
OF12 1st Floor Level	Ceiling Tiles	VK-07, VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Plaster Wall	VK-06							Non-ACM		
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Above Ceiling
	Ventilator Unit		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos
	Baseboard Mastic	V2018-0005							Non-ACM		Abated Aug 2012 / New Floor Tiles
	Baseboard Mastic	VK-03							Non-ACM		
	Ceiling Tiles	VK-07							Non-ACM		New Material Observed 2018
Classroom 413 1st Floor Level	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Plaster Wall	VK-06							Non-ACM		
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Above Ceiling, No Canvas
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos
	Baseboard Mastic	V2018-0003							Non-ACM		Abated Dec 2005, New 12" x 12" Tiles
	Baseboard Mastic	VK-03							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 414 1st Floor Level	Ceiling Tiles	VK-07, VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Abated Aug 2012 / New Flooring
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	V2018-0005							Non-ACM		
	Ventilator Unit		X	X				X	Assumed	Yes	Assumed Asbestos
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
W7 1st Floor Level	Thermal Insulation Fittings	VK-01							21% CHR		Abated Prior 2010
	Thermal Insulation Pipe Covering	SK-18							6% CHR		Abated Prior 2010
	Plaster Ceiling	VK-06							Non-ACM		No Access Above
	Interior Caulking		X	X		X			Assumed	No	Assumed Asbestos
	Ceiling Tiles	VK-07							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Ventilator Unit		X	X				X	Assumed	Yes	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
Room 415 1st Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
									Non-ACM		
									Non-ACM		
									Non-ACM		
									Non-ACM		
									Non-ACM		
									Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
OF13, OF14 1st Floor Level	Ceiling Tiles	VK-02, VK-13							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Present Above and Below Ceiling
	Vinyl Floor Tiles 9" x 9"								Assumed		Abated Dec 2005, New 12" x 12" Floor Tiles
Washroom In OF14 1st Floor Level	Plaster Ceiling	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material Observed 2018
	Baseboard Mastic	V2018-0003							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
Classroom 309 1st Floor Level	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		New Material Observed 2018
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Interior Caulking								Non-ACM		New Material
	Gold Mastic on Sink		X	X			X		Assumed	No	Assumed Asbestos
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Caretaker's Room Beside CR301 1st Floor Level	Plaster Ceiling	VK-06							Non-ACM		No Access Above
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
W6, W8 1st Floor Level Classroom 307 1st Floor Level	Plaster Ceiling	VK-06							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	SKDH1							Non-ACM		Not Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Interior Caulking								Non-ACM		New Material
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Vinyl Floor Tiles 12" x 12"	S2018-0014A-C							Non-ACM		
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 308 1st Floor Level	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Plaster Ceiling	V2018-0001							Non-ACM		No Access Above
Caretaker's Room Beside W7 1st Floor Level	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic	V2018-0003							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above Not Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		New Material Observed 2018
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Repaired Nov 21, 2007 / May 14, 2006 / January 26, 2016 / April 9, 2022
Classroom 305 1st Floor Level	Bakelite		X	X		X			Assumed	No	Assumed Asbestos
	Plaster	V2018-0001							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
									Non-ACM		
									Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
S2 1st Floor Level	Ceiling Tiles	VK-07							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic	V2018-0003							Non-ACM		
Classroom 303 1st Floor Level	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Above Ceiling
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation Above Ceiling
	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above Not Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		New Material Observed 2018
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos. Door repaired April 23, 2021
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Bakelite		X	X					Assumed	No	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Baseboard Mastic	V2018-0003							Non-ACM		New 12" x 12" Floor Tiles
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 306 1st Floor Level	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos - Repair door handle (Jan 22, 2019)
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Ceiling Tiles	VK-07							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
Classroom 304 1st Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	Not Canvased
	Transite Fume Hood		X	X		X			Assumed	No	Assumed Asbestos
	Bakelite		X	X		X			Assumed	No	Assumed Asbestos
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Plaster	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
S3 1st Floor Level	Ceiling Tiles	VK-07 V2018-0002							Non-ACM		No Access Above
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Fittings	VK-01	X	X		X	X		21% CHR	Yes	Abated May 26, 2009 Still Observed 2018
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
Classroom 503 1st Floor Level	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		No Access Above New Material Observed 2018
	Upper Ceiling Tiles	VK-17							Non-ACM		No Access Above
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Plaster Walls	VK-06							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	S2018-0009B	X	X		X			0.5% CHR	No	
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 506 1st Floor Level	Upper Ceiling Tiles	VK-17							Non-ACM		No Access Above
	Ceiling Tiles	VK-13							Non-ACM		New Materials Observed 2018
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Interior Caulking								Non-ACM		Repairs Done Summer 2004. Repairs done December 4, 2023.
	Chalkboard		X	X		X			Assumed	No	New Material
	Baseboard Mastic	V2018-0003							Non-ACM		Assumed Asbestos
S7 1st Floor Level	Baseboard Mastic	VK-04							Non-ACM		
	Plaster Ceiling	VK-06							Non-ACM		
	Interior Caulking								Non-ACM		No Access Above
	Baseboard Mastic	V2018-0003							Non-ACM		New Material
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos. Repairs made January 14, 2023
	Upper Ceiling Tiles	VK-17							Non-ACM		No Access Above
	Ceiling Tiles	VK-13							Non-ACM		New Material Observed 2018
Classroom 504 1st Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Chalkboard		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos
	Baseboard Mastic	V2018-0003							Non-ACM		Abated Dec 2007, New 12" x 12" Floor Tiles
	Baseboard Mastic	VK-04							Non-ACM		
									Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
S4 1st Floor Level	Plaster Ceiling	VK-06							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Thermal Insulation Pipe Fittings & Straights	VK-05							Non-ACM		Fibreglass Insulation
	Thermal Insulation Pipe Straights	S2018- 00168, C							Non-ACM		Cellulose Present on Rain Water Leader
	Baseboard Mastic	V2018- 0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
	Upper Ceiling Tiles	VK-17							Non-ACM		No Access Above
	Upper Ceiling Tiles	S2018- 00158							Non-ACM		
	Ceiling Tiles	VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018- 0002							Non-ACM		
Classroom 501 1st Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos - Repairs 13 Aug, 20 New Material
	Interior Caulking								Non-ACM		
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	S2018- 0009C	X	X		X			0.5% CHR	No	
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Baseboard Mastic	V2018- 0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
									Non-ACM		
									Non-ACM		
									Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible		
OF20 (Classroom 500) 1st Floor Level	Upper Ceiling Tiles	VK-17								No Access Above Not Observed 2018
	Ceiling Tiles	VK-13								
	Interior Caulking									New Material
	Baseboard Mastic	V2018-0003								
	Fire Door		X	X				X	Yes	Assumed Asbestos New Material Former ACM Flooring Removed
Washroom in OF20 1st Floor Level	Vinyl Floor Tiles 12" x 12"									
	Plaster Ceiling	V2018-0001								
	Baseboard Mastic	V2018-0003								No Access Above
	Vinyl Floor Tiles 12" x 12"									New Material
	Upper Ceiling Tiles	VK-17								No Access Above New Material Observed 2018
W9 1st Floor Level	Ceiling Tiles	VK-13								
	Ceiling Tiles	V2018-0006								
	Plaster Walls	VK-06								
	Plaster Ceiling	VK-06								
	Vinyl Floor Tiles 9" x 9"		X	X		X			No	Assumed Asbestos New Material
SS 1st Floor Level	Interior Caulking									
	Baseboard Mastic	V2018-0005								
	Baseboard Mastic	VK-04								Non-ACM

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible		
Library 502 1st Floor Level	Ceiling Tiles	VK-07, VK-13								New Material Observed 2018
	Ceiling Tiles	V2018-0002								
	Upper Texture Coat Ceiling	VK-14	X	X			X		Yes	
	Interior Caulking		X	X		X			No	Assumed Asbestos
	Plaster Ceiling	V2018-0001								
	Plaster Walls	VK-06								
	Carpeted Floor									Carpet Replaced in 2000
Library Office OF15 1st Floor Level	Ceiling Tiles	VK-07, VK-13								New Materials Observed 2018
	Ceiling Tiles	V2018-0002								
	Upper Texture Coat Ceiling	VK-14	X	X			X		Yes	
	Plaster Ceiling	V2018-0001								
	Plaster Walls	VK-06								
	Baseboard Mastic	V2018-0003								
	Gold Mastic on Sink		X	X			X		No	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"		X	X		X			No	Assumed Asbestos

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Friable (Y/N)	Asbestos Content	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
OF16, OF17 1st Floor Level	Ceiling Tiles	VK-02								Non-ACM	New Materials Observed 2018
	Ceiling Tiles	V2018-0002								Non-ACM	
	Upper Texture Coat Ceiling	VK-14	X	X			X		Yes	5-10% CHR	No Access Above
	Plaster Ceiling	V2018-0001								Non-ACM	
	Thermal Insulation Pipe Fittings	VK-01	X	X			X		Yes	21% CHR	
	Thermal Insulation Pipe Straights									Non-ACM	Fibreglass Insulation
Kitchen/Cafe 1st Floor Level	Plaster Walls	VK-06								Non-ACM	
	Upper Texture Coat Ceiling	VK-14	X	X			X		Yes	5-10% CHR	No Access Above
	Plaster Ceiling	V2018-0001								Non-ACM	
	Ceramic Tile		X	X						Non-ACM	Kitchen Retiled June 29, 2006
	Fire Door							X	Yes	Assumed	Assumed Asbestos
Servery Cafe 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		Yes	5-10% CHR	No Access Above
	Plaster Ceiling	V2018-0001								Non-ACM	

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible		
OF18 1st Floor Level	Ceiling Tiles	VK-07								No Access Above New Material Observed 2018
	Texture Coat Ceiling	VK-14								Abated June 29, 2009
	Vinyl Floor Tiles 9" x 9"		X	X		X			No	Assumed Asbestos, Abated June 29, 2009 Still Observed 2018
	Baseboard Mastic	VK-04								
	Baseboard Mastic	V2018-0003								
	Plaster Walls	VK-06								
	Fire Door		X	X				X	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights									Fibreglass Insulation
	Thermal Insulation Fittings	VK-01								Abated June 29, 2009
	Upper Texture Coat Ceiling	VK-14								Abated June 29, 2009
OF19 1st Floor Level	Plaster	V2018-0001								
	Ceiling Tiles	V2018-0006								New Material Observed 2018
	Ventilator Unit		X	X				X	Yes	Assumed Asbestos
	Interior Caulking									New Material
	Baseboard Mastic	V2018-0003								
	Fire Door		X	X				X	Yes	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"		X	X		X			No	Assumed Asbestos
	Plaster	V2018-0001								
	Ceiling Tiles	V2018-0006								
	Fire Door		X	X				X	Yes	Assumed Asbestos
W20 1st Floor Level	Vinyl Floor Tiles 12" x 12"	S2018-0011A								Assumed Asbestos

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
W19 1st Floor Level	Plaster	V2018-0001							Non-ACM		
	Baseboard Mastic	V2018-0003							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
W21 1st Floor Level	Plaster	V2018-0001							Non-ACM		
	Ceiling Tiles	V2018-0006							Non-ACM		
	Thermal Insulation Pipe Fittings & Straights								Non-ACM		Fibreglass Insulation
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	S2018-0011B,C							Non-ACM		
W10 1st Floor Level	Ceiling Tiles	VK-13 V2018-0006							Non-ACM		No Access Above
	Upper Texture Coat Ceiling	VK-14	X	X				X	5-10% CHR	Yes	No Access Above Repairs July 23, 2014
	Interior Caulking								Non-ACM		New Material
	Plaster Walls	VK-06							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 104 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X				X	5-10% CHR	Yes	No Access Above
	Ceiling Tiles	VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Wall Texture Coat	VK-15							Non-ACM		
	Plaster Wall	VK-06							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	White Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Abated Dec 2007 New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
Cafeteria 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		No Access Above New Material Observed 2018
	Plaster	V2018-0001							Non-ACM		
	Texture Coat Ceiling	VK-14 SKDH8	X	X				X	5-10% CHR	Yes	Above and Below Ceiling
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Repairs Done Dec 2011 Abated, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
S6 1st Floor Level	Plaster Ceiling and Walls	VK-06							Non-ACM		
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Repairs Done June 3, 2016, Patched with New 12" x 12" Tiles
	Baseboard Mastic	V2018-0005							Non-ACM		
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Wall Texture Coat	VK-15							Non-ACM		
	Thermal Insulation Fittings	VK-01	X	X		X	X		21% CHR	Yes	

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Old Boiler Room Basement Level Entrance in Custodial Room Beside CR102 1st Floor Level	Thermal Insulation Large Fittings	VK-01	X	X			X		21% CHR	Yes	Partially Abated. Repairs August 2019
	Thermal Insulation Small Fittings	VK-01	X	X			X		21% CHR	Yes	Partially Abated. Repairs August 2019
	Thermal Insulation Pipe Straights		X	X			X		Assumed	Yes	Assumed Asbestos Partially Abated
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		Fibreglass Insulation
	Thermal Insulation Breeching								Non-ACM		Fibreglass Insulation
	Thermal Insulation Pipe Straights & Fittings								Non-ACM		Armaflex Wrap
	Thermal Insulation Pipe Straights								Non-ACM		Cellulose on DW
	Parging Cement Fire Stop		X	X			X		Assumed	Yes	Assumed Asbestos
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Thermal Insulation Pipe Straights & Fittings								Non-ACM		Fibreglass Insulation
	Flex Connector								Non-ACM		New Material
	Flex Connector		X	X			X		Assumed	No	Assumed Asbestos
	Boiler								Non-ACM		Fibreglass Insulation (No Access Inside)
	Gaskets	VK-08							Non-ACM		
	Plaster	VK-06							Non-ACM		
	Hot Water Tank	SKDH15							20-30% CHR		Not Observed 2018
	Stack Cement	SKDH16							20-30% CHR		Present on Boiler 1 Not Observed 2018
	Stack Cement	SKDH17							20-30% CHR		Present on Boiler 2 Not Observed 2018
	Stack Cement	SKDH18							20-30% CHR		Present on Boiler 3 Not Observed 2018
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Abated Summer 2004

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
M1 1st Floor Entrance Basement Level	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Plaster	V2018-0001							Non-ACM		
	Interior Caulking								Non-ACM		New Material
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
OF9 1st Floor Level	Ceiling Tiles	VK-07, VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Plaster Ceiling and Walls	VK-06							Non-ACM		
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Baseboard Mastic	V2018-0003							Non-ACM		
	Interior Caulking		X	X				X	Assumed	No	
Classroom 102 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above Work Done Feb 4, 2008
	Ceiling Tiles	VK-13							Non-ACM		Not Observed 2018 New Material
	Plaster Wall	VK-06							Non-ACM		
	Texture Coat Wall	VK-15	X	X				X	Assumed	Yes	Assumed Asbestos
	Fire Door		X	X				X	Assumed	No	Assumed Asbestos (Painted)
	Transite Panels		X	X					Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Storage Room Off Room 102 1st Floor Level	Plaster Wall	VK-06							Non-ACM		
	Plaster Ceiling	VK-06							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018 New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		
OF4, 5 1st Floor Level	Ceiling Tiles	VK-07, VK-13							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Fire Door at OF5 Removed March 2015
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Plaster	V2018-0001							Non-ACM		
OF6 1st Floor Level	Vinyl Floor Tiles 12" x 12"								Non-ACM		
	Baseboard Mastic	V2018-0005							Non-ACM		
	Ceiling Tiles	V2018-0002							Non-ACM		New Material Observed 2018
	Ceiling Tiles	VK-07, VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
OF7, 8 1st Floor Level	Interior Caulking								Non-ACM		New Material
	Plaster	V2018-0001							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
S1 (Vault) 1st Floor Level (No Access) W5 1st Floor Level	Plaster Ceiling	VK-05							Non-ACM		No Access Above
	Plaster Wall	VK-06							Non-ACM		
	Baseboard Mastic	VK-03							Non-ACM		
	Plaster Ceiling	VK-06							Non-ACM		No Access Above
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
OF1 1st Floor Level	Baseboard Mastic	VK-03							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		New Material Observed 2018
	Ceiling Tiles	V2018-0002							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Repairs November 15, 2010
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
OF2, OF3 1st Floor Level	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Baseboard Mastic	VK-03							Non-ACM		Not Observed 2018
	Ceiling Tiles	VK-07, VK-13							Non-ACM		
	Ceiling Tiles	V2018-0002							Non-ACM		
	Ceiling Tiles	S2018-0018A-C							Non-ACM		
	Ceiling Tiles	V2018-0006							Non-ACM		
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
	Interior Caulking		X	X		X			Assumed	No	Assumed Asbestos
	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Baseboard Mastic	VK-03							Non-ACM		Not Observed 2018

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
SW1, SW2 1st Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster Ceiling and Walls	VK-06							Non-ACM		
	Texture Coat Wall	VK-15							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Ventilator Unit		X	X		X			Assumed	Yes	Assumed Asbestos Present in SW2 Only
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
Staff Room 4 2nd Floor Level	Ceiling Tiles	VK-13							Non-ACM		No Access Above Not Observed 2018
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	
	Plaster Ceiling and Walls	VK-06							Non-ACM		
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Ceiling Tiles	S2018-0002B							Non-ACM		
	Vinyl Floor Tiles 12" x 12"								Non-ACM		
W4 2nd Floor Level	Baseboard Mastic	S2018-0003B							Non-ACM		
	Ventilator Unit		X	X				X	Assumed	Yes	Assumed Asbestos
	Interior Caulking								Non-ACM		New Material
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-03							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
OF27 2nd Floor Level	Ceiling Tiles	S2018-0002C							Non-ACM		
	Plaster Ceiling and Walls	S2018-0001F							Non-ACM		
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Ventilator Unit		X	X				X	Assumed	Yes	Assumed Asbestos
Staff Room 2 2nd Floor Level (No Longer Present)	Upper Texture Coat Ceiling	VK-14							5-10% CHR		No Access Above
	Plaster Wall	VK-06							Non-ACM		
	Upper Texture Coat Ceiling	VK-14							5-10% CHR		No Access Above
	Plaster Wall	VK-06							Non-ACM		
W3 2nd Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Baseboard Mastic	VK-03							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Staff Kitchen 2nd Floor Level (No Longer Present)	Upper Texture Coat Ceiling	VK-14							5-10% CHR		No Access Above
	Plaster Wall	VK-06							Non-ACM		
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos
	Baseboard Mastic	VK-04							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		
Staff Corridor 2nd Floor Level	Ceiling Tiles	V2018-0002							Non-ACM		
	Plaster Ceiling and Walls	VK-06	X	X				X	Non-ACM	Yes	Assumed Asbestos
	Fire Door		X	X		X			Assumed	No	Assumed Asbestos
	Interior Caulking		X	X				X	Assumed	Yes	Assumed Asbestos
	Ventilator Unit		X	X					Assumed		Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos
	Baseboard Mastic	V2018-0003							Non-ACM		Abated 2004 / New 12" x 12" Floor Tiles
	Baseboard Mastic	VK-04							Non-ACM		
	Ceiling Tiles	VK-07							Non-ACM		Limited Access Above New Material Observed 2018
	Interior Caulking		X	X		X			Assumed	No	Assumed Asbestos
Classroom 603 2nd Floor Level	Ventilator Unit		X	X				X	Assumed	Yes	Assumed Asbestos
	Baseboard Mastic	S2018-0005B							Non-ACM		
	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 607 2nd Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster Ceiling and Walls	VK-06							Non-ACM		
	Ventilator Unit		X	X		X			Assumed	Yes	Assumed Asbestos
	Ceiling Tiles	V2018-0002							Non-ACM		New Material Observed 2018
	Baseboard Mastic	VK-03, VK-04							Non-ACM		
OF28 2nd Floor Level	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Ceiling Tiles	V2018-0002							Non-ACM		New Material Observed 2018
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	
	Plaster Ceiling and Walls	VK-06	X	X				X	Non-ACM	Yes	Assumed Asbestos
	Ventilator Unit								Assumed		New Material
M8 Roof Level	Flex Connector								Non-ACM		Fibreglass Insulation
	Thermal Insulation Duct Covering								Non-ACM		One damaged fitting repaired August 2019
	Thermal Insulation Pipe Fittings	VK-01	X	X			X		21% CHR	Yes	Fibreglass Insulation
	Thermal Insulation Pipe Straights								Non-ACM		
	Thermal Insulation on Ducting	S2018-00048							Non-ACM		
Classroom 606 2nd Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Ceiling Tiles	VK-07							Non-ACM		No Access Above New Material Observed 2018
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Vinyl Floor Tiles 12" x 12"	S2018-00078	X	X		X			2% CHR	No	
	Baseboard Mastic	VK-03							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001).
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001).

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Classroom 604 2nd Floor Level	Ceiling Tiles	VK-07							Non-ACM		No Access Above New Material Observed 2018
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	S2018-0008A	X	X		X			3% CHR	No	
	Baseboard Mastic	VK-03							Non-ACM		
	Ceiling Tiles	VK-07, VK-13							Non-ACM		New Material Observed 2018
Classroom 601 and 602 2nd Floor Level	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Vinyl Floor Tiles 12" x 12"	S2018-0007C	X	X		X			2% CHR	No	In CR602
	Vinyl Floor Tiles 12" x 12"	S2018-0008B	X	X		X			3% CHR	No	In CR601
	Baseboard Mastic	VK-03							Non-ACM		
W1, W2 2nd Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster	V2018-0001							Non-ACM		
M5 2nd Floor Level	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster	V2018-0001							Non-ACM		
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		
	Baseboard Mastic	VK-03							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001).
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001).

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
H6 2nd Floor Level	Ceiling Tiles	VK-07							Non-ACM		No Access Above
	Ceiling Tiles	S2018-0006B							Non-ACM		
	Vinyl Floor Tiles 12" x 12"								Non-ACM		Retiled July 2002
	Fire Door								Assumed		Assumed Asbestos Repairs Done Aug 25, 2008, Abated All ACM Doors July 21, 2010
	Plaster	V2018-0001							Non-ACM		
	Texture Coat Walls	VK-15							Non-ACM		
C2 1st Floor Level	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Plaster Ceiling	VK-06									
	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	VK-04							Non-ACM		
	Ceiling Tiles	SK-19							Non-ACM		Limited Access Above
	Ceiling Tiles			X		X			Non-ACM	Yes	Cellulose with Fabric Covering
Music Room 301 1st Floor Level	Texture Coat	SK-18A	X	X					2-4% CHR		
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
	Plaster	V2018-0001							Non-ACM		
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos Not Observed 2018, Carpeted Floor
	Plaster Ceiling	V2018-0001							Non-ACM		
Storage Room in 301 1st Floor Level	Vinyl Floor Tiles 9" x 9"		X	X		X			Assumed	No	Assumed Asbestos
	Baseboard Mastic	V2018-0005							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001).
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001).

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Music Room 302 (Includes Practice Rooms) 1st Floor Level	Ceiling Tiles	VK-13 V2018-0006							Non-ACM		No Access Above
	Ceiling Tiles	S2018-0012B, C							Non-ACM		
	Thermal Insulation Pipe Covering	VK-18	X	X		X			6% CHR	Yes	Present Under Sink
	Thermal Insulation Pipe Covering	S2018-0013A-C	X	X		X			3% CHR	No	Present Under Sink
	Baseboard Mastic	VK-04							Non-ACM		
	Baseboard Mastic	V2018-0003							Non-ACM		
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
OF21 1st Floor Level	Ceiling Tiles	VK-13							Non-ACM		No Access Above New Material Observed 2018
	Ceiling Tiles	S2018-0012A							Non-ACM		
	Baseboard Mastic	VK-03							Non-ACM		
	Baseboard Mastic	V2018-0003							Non-ACM		
	Vinyl Floor Tiles 12" x 12"								Non-ACM		New 12" x 12" Floor Tiles
	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Upper Texture Coat Ceiling	VK-14	X	X			X		5-10% CHR	Yes	No Access Above
Mechanical Room Off Music Office 1st Floor Level	Plaster Wall	VK-06							Non-ACM		
	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Flex Connector								Non-ACM		New Material
	Vinyl Floor Tiles 12" x 12"	V2018-0007	X	X		X			2% CHR	No	
	Vinyl Floor Tiles 12" x 12"	VK-16							Non-ACM		Not Observed 2018
	Baseboard Mastic	V2018-0005							Non-ACM		
	Baseboard Mastic	VK-04							Non-ACM		

Samples analyzed are identified by the prefix 'S' (e.g. S0001)

Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
S8 1st Floor Level	Thermal Insulation Duct Covering	SK-20	X	X				X	10-20% CHR	No	
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Duct Covering								Non-ACM		Fibreglass Insulation
	Plaster Ceiling	VK-06							Non-ACM		
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Flex Connector								Non-ACM		New Material
	Vinyl Floor Tiles 9" x 9"								Assumed		Assumed Asbestos
	Baseboard Mastic	VK-04							Non-ACM		Not Observed 2018, New 12" x 12" Floor Tiles
	Baseboard Mastic	V2018-0003							Non-ACM		
	Fire Door								Assumed		Assumed Asbestos Abated Feb 10, 2011
E1 1st Floor Level 201 To 203 / HS 1st Floor Level	Thermal Insulation Fittings	VK-01							21% CHR		Abated
	Plaster Ceiling	VK-06							Non-ACM		
	Ceiling Tiles	VK-13							Non-ACM		Limited Visibility Above
	Fire Door		X	X				X	Assumed	Yes	Assumed Asbestos Repairs Nov 29, 2005
	Wall Texture Coat	VK-15							Non-ACM		
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	
	Thermal Insulation Pipe Straights	SKDH13							Non-ACM		Plumbing leak repaired March 31, 2021. Plumbing leak repaired at Exit 15 Jan 14, 2023
	Thermal Insulation Pipe Fittings	SKDH14	X	X			X		10-20% CHR	Yes	
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
H5 /H1 /H2 /SW3 /SW4 /SW5 1st Floor Level	Ceiling Tiles								Non-ACM		All Types of Ceiling Tiles Present
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Pipe Straights	SKHD13							Non-ACM		Present in H5 Only
	Thermal Insulation Fittings	SKHD14	X	X			X		10-20% CHR	Yes	Present in H5 Only
	Upper Ceiling Tiles	S2018-0015C							Non-ACM		
	Fire Door		X	X					Assumed	Yes	Assumed Asbestos Repairs Nov 29, 2005 / Dec 5, 2007 H5/H1/H2 Abated July 21, 2010
	Texture Coat Ceiling	VK-18A SKDH21	X	X			X		2-4% CHR	Yes	Both Exposed and Above Ceilings Present in H1 / H2
	Plaster	V2018-0001							Non-ACM		
	Troweled on Fire Stop	S2018-0017A-C							Non-ACM		
	Thermal Insulation Pipe Wrap		X	X			X		Assumed	No	Assumed Asbestos, Black Mastic Pipe Wrap Over Fittings
	Wall Texture Coat	VK-15							Non-ACM		
	Thermal Insulation Pipe Straights	VK-05							Non-ACM		
	Thermal Insulation Pipe Straights & Duct Covering								Non-ACM		Fibreglass Insulation

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
H3/H4 1st Floor Level	Ceiling Tiles								Non-ACM		All Types of Ceiling Tiles Present (Including 12' x 12' Upper Ceiling Tiles)
	Thermal Insulation Fittings	VK-01	X	X			X		21% CHR	Yes	
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Ceiling Tiles	SKDH2 SKDH5 SKDH6							Non-ACM		Not Observed 2018
	Fire Door								Assumed		Assumed Asbestos Repairs Nov 29, 2005, Abated July 21, 2010
	Plaster	V2018-0001							Non-ACM		
Roof Top Exterior, Interior,	Texture Coat Ceiling	VK-18A	X	X			X		2-4% CHR	Yes	Above Ceiling H4
	Wall Texture Coat	VK-15							Non-ACM		
									Non-ACM		New Material
	Vermiculite Inside Walls		X	X				X	Assumed	Yes	Assumed Asbestos
	Caulking		X	X				X	Assumed	No	Assumed Asbestos
	Firestop Materials		X	X		X			Assumed	No	Assumed Asbestos

Samples analyzed are identified by the prefix 'S' (e.g. S0001)

Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Designated Substance Management Plan - TABLE # 49
 Last Revised: March 1, 2025
 Building Name: Kingsville District High School

Location	Material Examined	Sample Number	Condition						Comments
			Good	Fair	Poor				
Interior/Exterior Throughout	Lead - All Paints & Varnishes	N/A	X	X					Assume Lead-Containing. Damaged paint in OF3 and OF2 repaired August 2019
	Lead - Painted Lockers H2 & H3	N/A							Approximately 30,000 to 54,000 PPM Lead containing abated prior to 2014
	Lead - Piping, Machinery, Equipment, Batteries	N/A							Assume Lead-Containing
Interior/Exterior Throughout	Silica - All Concrete, Brick, Masonry, Terrazzo, Ceiling Tiles, Sand	N/A							Assume Silica-Containing
Art Class/Pottery	Silica - Clay Body 700	N/A							Assume Silica-Containing
Interior/Exterior Throughout	Mercury - Some Thermostats, Switches, Batteries, Fluorescent Bulbs	N/A							Assume Mercury-Containing

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Designated Substance Management Plan - TABLE # 50

Last Revised: March 1, 2025

Building Name: Migration Hall - Kingsville District High School

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Migration Hall Gym	Ceiling Tiles								Non-ACM		New Material
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Pipe Fittings								Non-ACM		Fibreglass Insulation
	Baseboard Mastic								Non-ACM		New Material
Migration Hall W1	Ceiling Tiles								Non-ACM		Date Stamped
Migration Hall W2	Ceiling Tiles								Non-ACM		New Material
	Ceiling Tiles								Non-ACM		Date Stamped
Migration Hall Multipurpose Room	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
	Interior Window Caulking		X	X		X			Assumed	No	Assumed Asbestos
	Ceiling Tiles								Non-ACM		New Material
Migration Hall S2 / OF1	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
	Ceiling Tiles								Non-ACM		New Material
Migration Hall Sentry	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
	Gold Mastic on Sink		X	X		X			Assumed	No	Assumed Asbestos
	Ceiling Tiles								Non-ACM		New Material

Samples analyzed are identified by the prefix 'S' (e.g. S0001).

Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001).

Designated Substance Management Plan - TABLE # 51

Last Revised: March 1, 2025

Building Name: Migration Hall - Kingsville District High School

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Migration Hall D1	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
	Ceiling Tiles								Non-ACM		Date Stamped
	Ceiling Tiles								Non-ACM		New Material
Migration Hall Washroom 1 in D1	Ceiling Tiles								Non-ACM		Date Stamped
	Drywall Joint Compound		X	X		X			Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
Migration Hall Stage	Ceiling Tiles								Non-ACM		Date Stamped
	Ceiling Tiles								Non-ACM		New Material
	Thermal Insulation Pipe Straights								Non-ACM		Fibreglass Insulation
	Thermal Insulation Pipe Fittings								Non-ACM		Fibreglass Insulation
Migration Hall D2	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
	Ceiling Tiles								Non-ACM		Date Stamped
	Ceiling Tiles								Non-ACM		New Material
Migration Hall Washroom 1 in D2	Ceiling Tiles								Non-ACM		Date Stamped
	Drywall Joint Compound		X	X		X			Assumed	Yes	Assumed Asbestos
	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
Migration Hall Washroom 2 in D2	Ceiling Tiles								Non-ACM		Date Stamped
	Ceiling Tiles								Non-ACM		New Material
	Ceiling Tiles								Non-ACM		Date Stamped
	Ceiling Tiles								Non-ACM		New Material

Samples analyzed are identified by the prefix 'S' (e.g. S0001)
 Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Designated Substance Management Plan - TABLE # 52

Last Revised: March 1, 2025

Building Name: Migration Hall - Kingsville District High School

Location	Material Examined	Sample Number	Condition			Accessibility			Asbestos Content	Friable (Y/N)	Comments
			Good	Fair	Poor	Accessible	Rarely Accessible	Not Accessible			
Migration Hall S1	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Baseboard Mastic								Non-ACM		New Material
Migration Hall E1	Thermal Insulation on Ducting								Non-ACM		Fibreglass Insulation
Migration Hall C1	Vinyl Floor Tiles 12" x 12"								Non-ACM		New Material
	Drywall Joint Compound		X	X		X			Assumed	Yes	Assumed Asbestos
	Ceiling Tiles								Non-ACM		New Material
Migration Hall Foyer	Ceramic Tile								Non-ACM		New Material
	Ceiling Tiles								Non-ACM		New Material
Migration Hall M1											No Access
Migration Hall Storage off Foyer											No Access
Roof Top Exterior, Interior Building									Non-ACM		New Material
	Vermiculite Inside Exterior Block Walls								NA		An aggressive survey was done by IES in September 2021, which concluded that Vermiculite is not present
	Caulking		X	X		X			Assumed	No	Assumed Asbestos
	Firestop Materials		X	X		X			Assumed	No	Assumed Asbestos

Samples analyzed are identified by the prefix 'S' (e.g. S0001)

Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

Designated Substance Management Plan - TABLE # 53


Last Revised: March 1, 2025

Building Name: Migration Hall - Kingsville District High School

Location	Material Examined	Sample Number	Condition						Comments
			Good	Fair	Poor				
Interior/Exterior Throughout	Lead - All Paints & Varnishes	N/A	X	X					Assume Lead-Containing
	Lead - Piping, Machinery, Equipment, Batteries	N/A							Assume Lead-Containing
Interior/Exterior Throughout	Silica - All Concrete, Brick, Masonry, Terrazzo, Ceiling Tiles, Sand	N/A							Assume Silica-Containing
Art Class/Pottery	Silica - Clay Body 700	N/A							Assume Silica-Containing
Interior/Exterior Throughout	Mercury - Some Thermostats, Switches, Batteries, Fluorescent Bulbs	N/A							Assume Mercury-Containing

Samples analyzed are identified by the prefix 'S' (e.g. S0001)

Samples not collected but visually similar to other samples collected are identified by the prefix 'V' (e.g. V0001)

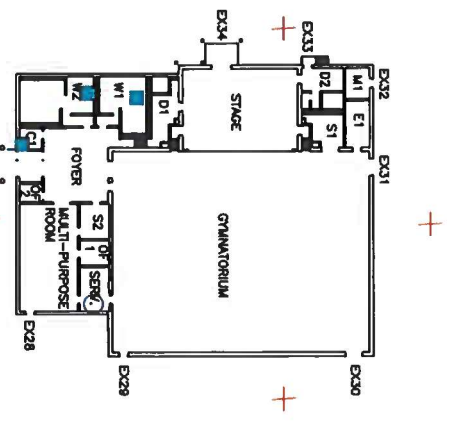

MIGRATION HALL

ASBESTOS LEGEND

- ▲ FIRE DOOR LINING
- × THERMAL INSULATION
- FLOOR TILES
- UNVENTILATOR
- TEXTURE COATING
- ◆ TRANSITE
- DRYWALL JFC
- * CHALKBOARD & BULLETIN BOARD ADHESIVES
- + INTERIOR & EXTERIOR CAULKING
- BAKELITE
- SINK MASTIC
- REFRACTORY BLOCK

NOTE: SEE IN OR AROUND THE SYMBOL

LEGEND

- M = MECHANICAL ROOM
- W = WASHROOM
- D = DRESSING ROOM
- EX = EXIT
- S = STORAGE
- CR = CLASSROOM
- C = CUSTODIAL AREA
- H = HALLWAY
- OF = OFFICE AREA
- E = ELECTRICAL ROOM
- B = BOILER ROOM
- SW = STAIRWELL

- DESIGNATED SUBSTANCES NOTES:**
1. THE BUILDING WAS BUILT PRIOR TO 1980 AND ALL PAINTS AND VARNISHES ARE ASSUMED TO CONTAIN LEAD. ALL PIPING, MACHINERY, EQUIPMENT AND BATTERIES MAY POSSIBLY CONTAIN LEAD.
 2. TERRAZZO, CERAMIC TILE FLOORS AND LIKE MATERIALS ARE ASSUMED TO CONTAIN SILICA.
 3. ALL THERMOSTATS, THERMOMETERS, SWITCHES, BATTERIES AND FLUORESCENT LAMP TUBS ARE ASSUMED TO CONTAIN MERCURY.



YES TUNNELS ARE PRESENT
YES ASBESTOS IS PRESENT

GREATER ESSEX COUNTY
DISTRICT SCHOOL BOARD
KINGSVILLE DISTRICT H.S.

TITLE: DESIGNATED SUBSTANCE

FIRST FLOOR

DRAWN BY: A.S.

SCALE: N.T.S.


DATE: MAY 3, 2022

ADDRESS: 170 MAIN ST E
KINGSVILLE, ON.
N9Y 1A6

YES TUNNELS ARE PRESENT
YES ASBESTOS IS PRESENT

LEGEND
M = MECHANICAL ROOM
W = WASHROOM
D = DRESSING ROOM
EX = EXIT
S = STORAGE
CR = CLASSROOM
C = CUSTODIAL AREA
H = HALLWAY
OF = OFFICE AREA
E = ELECTRICAL ROOM
B = BOILER ROOM
SW = STAIRWELL

ASBESTOS LEGEND
▲ FIRE DOOR LINING
X THERMAL INSULATION
● FLOOR TILES
● UNVENTILATOR
■ TEXTURE COATING
◆ TRANSITE
■ DRYWALL JFC
* CHALKBOARD & BULLETIN BOARD ADHESIVES
+ INTERIOR & EXTERIOR CAULKING
● BAKELITE
○ SINK MASTIC
R REFRACTORY BLOCK
NOTE: ASBESTOS MAY BE IN OR AROUND THE SYMBOL

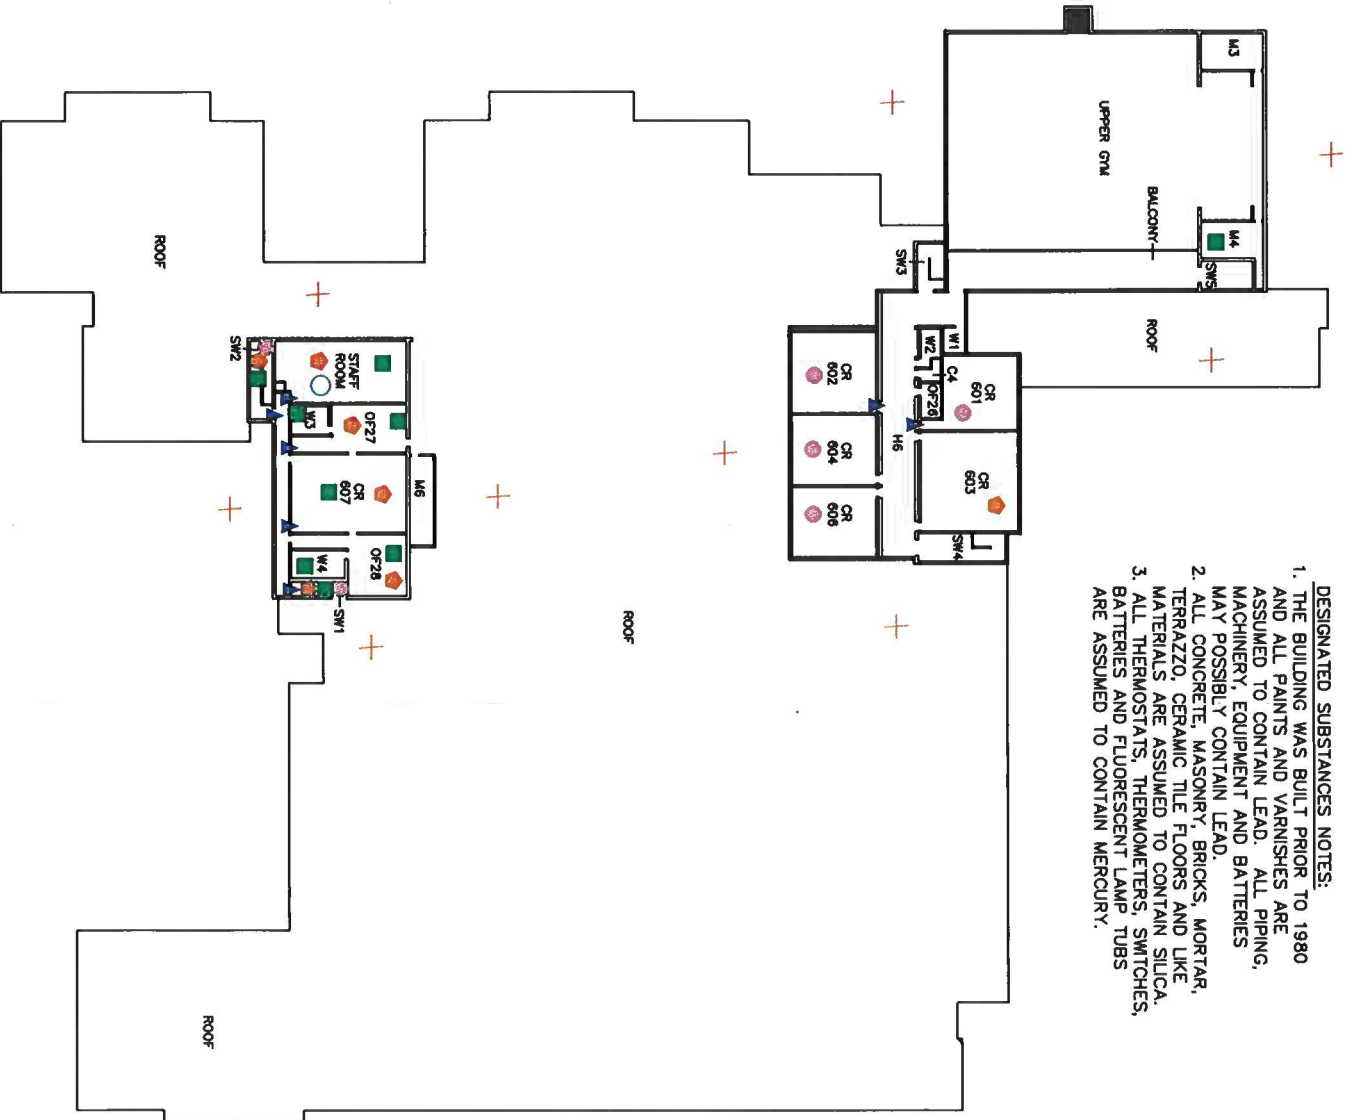

- DESIGNATED SUBSTANCES NOTES:
1. THE BUILDING WAS BUILT PRIOR TO 1980 AND ALL PAINTS AND VARNISHES ARE ASSUMED TO CONTAIN LEAD. ALL PIPING, MACHINERY, EQUIPMENT AND BATTERIES MAY POSSIBLY CONTAIN LEAD.
 2. ALL CONCRETE, MASONRY, BRICKS, MORTAR, TERRAZZO, CERAMIC TILE FLOORS AND LIKE MATERIALS ARE ASSUMED TO CONTAIN SILICA.
 3. ALL THERMOSTATS, THERMOMETERS, SWITCHES, BATTERIES AND FLUORESCENT LAMP TUBES ARE ASSUMED TO CONTAIN MERCURY.

GREATER ESSEX COUNTY
DISTRICT SCHOOL BOARD
KINGSVILLE DISTRICT H.S.

TITLE:

DESIGNATED
SUBSTANCES

SECOND
FLOOR

DRAWN BY:
A.S.

SCALE:

N.T.S.

DATE:

MAY 3, 2022

ADDRESS:

170 MAIN ST E
KINGSVILLE, ONT.
N9Y 1A6